



South West Hertfordshire Secondary  
Schools  
Site B

Noise Review



# South West Hertfordshire Secondary Schools Site B

## Noise Review

JMP Consultants Limited  
85-89 Colmore Row  
Birmingham  
B3 2BB

T 0121 230 6010  
F 0121 230 6011  
E birmingham@jmp.co.uk

[www.jmp.co.uk](http://www.jmp.co.uk)

Job No. MID3172

---

Report No. R.007

---

Prepared by MD

---

Verified PJB

---

Approved by CB

---

Status FINAL

---

Issue No. 1

---

Date 06 September 2011

---



## South West Hertfordshire Secondary Schools Site B

Noise Review

Contents Amendments Record

This document has been issued and amended as follows:

Status/Revision	Revision description	Issue Number	Approved By	Date
DRAFT	First issue	0	CB	05/08/2011
FINAL	Conclusions updated to include more detail relating to noise barriers. Status changed to FINAL.	1	CB	06/09/2011



## Contents

1	INTRODUCTION .....	1
	General .....	1
	Scope of the Noise Review .....	1
	Report Structure .....	2
2	NOISE CONTEXT .....	3
	General .....	3
	Relevant Guidance .....	3
3	METHODOLOGY .....	5
	Noise Monitoring .....	5
	Noise Meter .....	6
4	RESULTS .....	7
5	CONSTRUCTION IMPACTS.....	9
	General .....	9
	Recommended Measures .....	9
6	CONCLUSIONS .....	10

## Tables and Figures

Table 2.1	Recommended BB93 noise levels .....	4
Table 2.2	BS8223:1999 Recommended noise levels .....	4
Table 2.3	World Health Organisation recommended noise levels .....	4
Table 4.1	Noise levels at the monitoring locations.....	7
Table 4.2	Offset distances required .....	8
Figure 1.1	Site location.....	1
Figure 3.1	Monitoring locations .....	5

## Appendices

APPENDIX A Calculations



# 1 Introduction

## General

- 1.1 JMP Consultants Ltd has been commissioned by Hertfordshire County Council to undertake a Noise Review and comparison of the noise environment at four potential secondary school sites (Site A, Site B, Site C and Site D), to support the LDF preparation process.
- 1.2 This report focuses on Site B, which is located on land south of A412, and north of Maple Lodge Close. The north-western boundary of the site is adjacent to the junction between the A405 and A412. The site location is shown in Figure 1.1.

**Figure 1.1 Site location**



Source: OS OpenData. Contains Ordnance Survey data © Crown copyright and database right 2011

## Scope of the Noise Review

- 1.3 In order to establish the noise environment around the school site this Noise Review will present the findings of a period of noise monitoring undertaken within and around the proposed school site.
- 1.4 An Executive Summary document containing an appraisal of the noise environment at all four potential sites has been produce separately.

## Report Structure

1.5 Following this introductory section the structure of the this report is as follows:

- **Section 2** defines the noise and planning context of the proposed development and the local area.
- **Section 3** describes the methodology applied to the assessment, specifically the requirements of BB93 *Acoustic Design of Schools a Design Guide*.
- **Section 4** presents the assessment findings and summarises the results.
- **Section 5** presents the construction impacts of the proposed development.
- **Section 6** presents the conclusions of the study.

## 2 Noise Context

### General

- 2.1 This section of the report outlines the noise context of the proposed development, particularly with regard to relevant guidance documents. Sound levels and the health impact of noise are also discussed.

### The Health Impact of Noise

- 2.2 Long-term exposure to noise (unwanted sound) has been shown to have a negative impact on human health and general wellbeing. The World Health Organisation (WHO) estimates that one in three Europeans is adversely affected by traffic noise. The detrimental effects of traffic noise include the following (source: WHO, 2008).

- Pain and hearing fatigue;
- Hearing impairment including tinnitus;
- Annoyance;
- Interferences with social behaviour (aggressiveness, protest and helplessness);
- Interference with speech communication;
- Sleep disturbance and all its consequences on a long and short term basis;
- Cardiovascular effects;
- Hormonal responses (stress hormones) and their possible consequences on human metabolism (nutrition) and immune system; and
- Poor performance at work and school.

- 2.3 As a consequence of the health implications of exposure to noise, it is often considered necessary to determine the existing transport-related noise level at a location of a proposed school development. This planning requirement is principally addressed by Building Bulletin 93 (BB93) 'Acoustic Design of Schools a Design Guide'. With regard to acceptable internal noise levels, BS8233 'Sound Insulation and Noise Reduction for Buildings' and the World Health Organisation have recommended limits for school buildings.

### Relevant Guidance

#### BB 93 Acoustic Design of Schools a Design Guide

BB93 provide s regulatory framework for the acoustic design of schools. At the feasibility stage of the planning and design process BB93 recommends that a noise survey is undertaken to establish the suitability of a site for a school development. This Noise Review presents the findings of a noise survey undertaken to do this. Table 2.1 below shows the recommended external noise levels within a playground and at the boundary of a proposed school building.

**Table 2.1 Recommended BB93 noise levels**

Criterion	Ideal	Limit
The boundary of external premises used for formal and informal teaching	60dB(A) $L_{Aeq\ 30min}$	
Noise level in an unoccupied playing fields	50dBA $L_{Aeq\ 30min}$	55dBA $L_{Aeq\ 30min}$
Area used for outdoor teaching activities	At least one area should be below 50dBA $L_{Aeq\ 30min}$	

Source: BB93

### BS8223:1999 Sound Insulation and Noise Reduction for Buildings

- 2.4 BS8223, Table 5 recommends internal noise levels for new or refurbished buildings. These internal noise limits are primarily intended to apply to new or refurbished buildings and are not for the assessment of changes in the external noise environment. Table 2.2 below shows the internal noise levels recommended in BS8223.

**Table 2.2 BS8223:1999 Recommended noise levels**

Criterion	Typical situations	Design range $L_{AeqT}$ dB(A)	
		Good	Reasonable
Reasonable listening conditions	Classroom	35	40
Reasonable conditions for study and work requiring concentration	Library	40	50

Source: BS8233

- 2.5 In order to convert a monitored noise level to an internal noise level, in accordance with BS8233, it is assumed that:
- An open window will provide a decibel reduction of 13dB(A).
  - A closed double glazed window (specification 6-12-6) will reduce external noise levels by 34dB(A).
  - A closed secondary glazed window (specification 4-200-4) will reduce external noise levels by 43dB(A).

### World Health Organisation Guidelines for Community Noise

- 2.6 *Guidelines for Community Noise*, published by the World Health Organisation in 1999, states that, in order to prevent speech interference the internal background noise level within a classroom should not exceed 35dB(A)  $L_{Aeq}$  during a teaching session. In outdoor playground areas noise from external sources should not exceed 55dB(A)  $L_{Aeq}$ . Table 2.3 shows the noise levels recommended in this document.

**Table 2.3 World Health Organisation recommended noise levels**

Specific environment	$L_{Aeq}$ dB(A)	Time base (hours)
School classrooms	35	During Class
School playground outdoor	55	During Play


Source: *Guidelines for Community Noise*, World Health Organisation (1999)

### 3 Methodology

#### Noise Monitoring

- 3.1 To determine the noise levels at the site, it was necessary to conduct a period of on-site noise monitoring. The on-site noise monitoring was conducted by a JMP staff member who has attained the Institute of Acoustics (IOA) *Certificate of Competence in Environmental Noise Measurement*.
- 3.2 At this feasibility stage, noise was monitored for a limited period at the locations indicated in Figure 3.1 below. The monitoring locations were selected due to their proximity to nearby traffic noise sources and the proposed locations of playgrounds and school buildings.
- 3.3 The monitoring was undertaken during typical school hours (including a peak traffic period) on Wednesday 13<sup>th</sup> July 2011 between 09:00 and 13:45. At each specified point noise was measured for periods of 15 minutes at various times throughout the monitoring period. During the monitoring period weather conditions were dry and warm with low wind speeds.

**Figure 3.1 Monitoring locations**

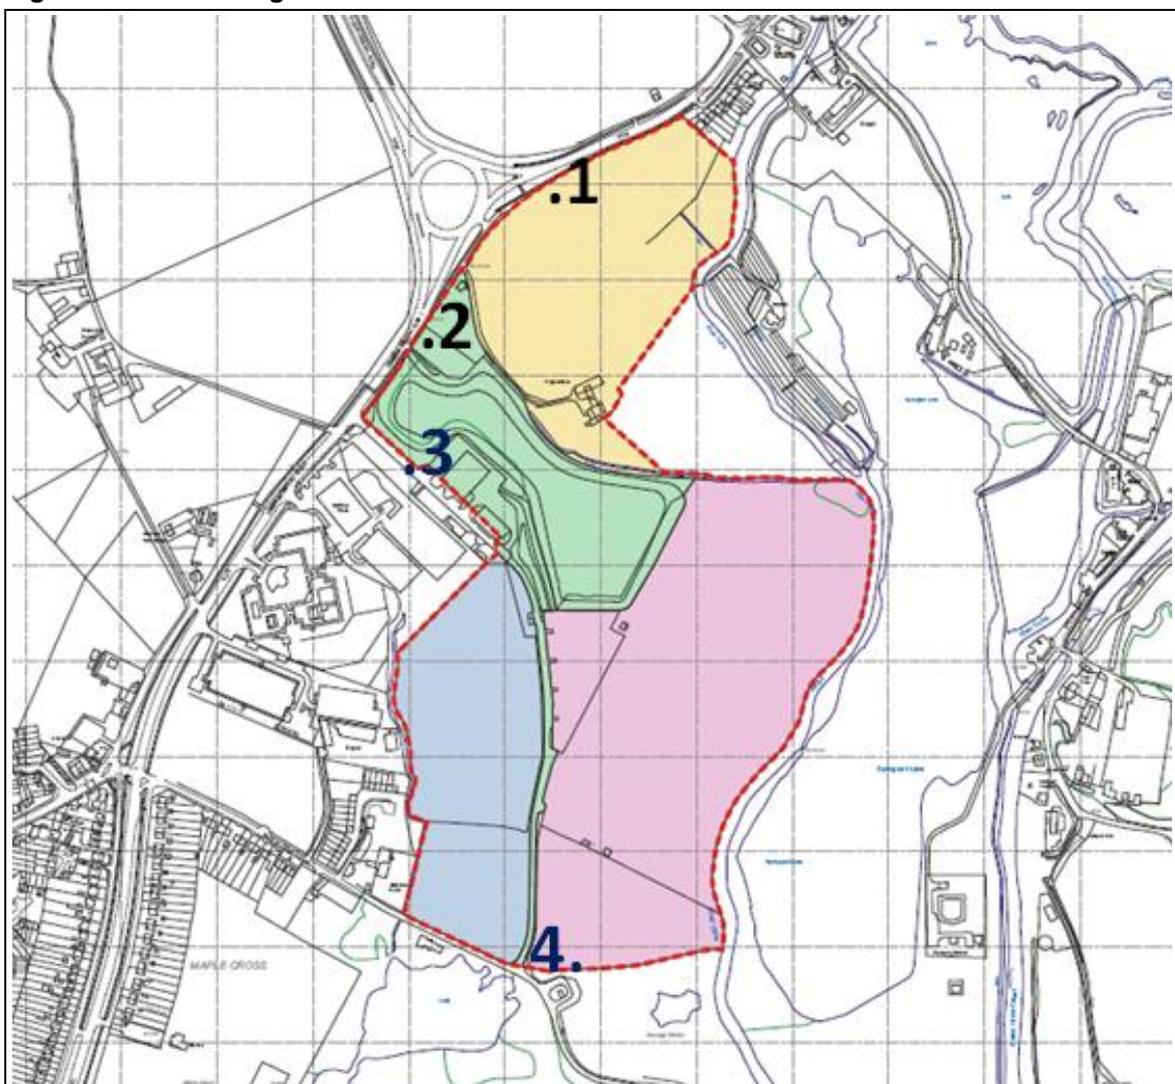

Source: JMP

## Noise Meter

- 3.4 Noise was monitored using a Norsonic 140 integrated sound level meter and a Casella 440 integrated sound level meter. All measurements were A-weighted and recorded using a fast time response. The noise meter was set at a height of 1.5m above the ground.
- 3.5 The Norsonic noise meter was calibrated using a Norsonic calibrator at the beginning and end of each monitoring period. The Casella noise meter was calibrated using a CEL-284/2 calibrator at the beginning and end of each monitoring period. No significant deviations were observed. Calibration certificates can be provided upon request.

## 4 Results

### Noise Environment

4.1 Measured external noise levels at the monitoring locations are shown below in Table 4.1.

**Table 4.1 Noise levels at the monitoring locations**

Location / distance from dominant noise source(s)	Time		L <sub>Aeq 15min</sub> dB(A) *	Observed noise sources
	Start	Stop		
1 10m from A412	10:01	10:16	64.8	Noise from the A412 was dominant.
	13:00	13:15	62.8	
	-	-	-	
	Arithmetic Average		<b>63.8</b>	
2 10m from A412	09:00	09:15	59.8	Noise from the A412 was dominant.
	10:18	10:33	63.1	
	12:42	12:57	57.5	
	Arithmetic Average		<b>60.1</b>	
3 30m from A412	09:18	09:33	57.3	Noise from the A412 was dominant.
	12:26	12:41	57.1	
	12:41	12:56	53.6	
	Arithmetic Average		<b>56.0</b>	
4 1m <sup>^</sup> from Maple Lodge Close	13:30	13:45	59.2	Noise from Maple Lodge Close was dominant.
	-	-	-	
	-	-	-	
	Arithmetic Average		<b>59.2</b>	

\* The Ambient Noise Level during the monitoring period was consistent. Therefore the 15 minute measurements are considered representative of a 30 minute period.

<sup>^</sup> It was not possible to monitor further back from the road at this point.

## Analysis

### Playground Area – The Ideal Noise Limit

- 4.2 The noise levels measured at all the locations indicated in Figure 3.1 exceed the ideal limit of 50dB(A) L<sub>Aeq30min</sub> recommended by BB93 for an area used for outdoor teaching. This ideal noise limit must be met at at least one outdoor teaching location.
- 4.3 It should be noted that the monitoring positions were located on the boundary of the site close to road traffic noise sources. With increasing distance from the site boundary, noise levels will decrease and the ideal limit may be met.
- 4.4 From the data collected, the quietest parts of the site are located away from the north western boundary of the site with the A412.

4.5 At location 4, noise was monitored at a distance of 1m from the carriageway edge of Maple Lodge Close. Using a line source distance attenuation calculation, as shown in **Appendix A**, it can be inferred that at a distance of 8.5m from Maple Lodge Close, the lower noise limit level of 50dB(A)  $L_{Aeq30min}$  can be achieved. To achieve the same result for monitoring position 3, the outdoor teaching area will need to be at least 120m of the A412.

#### Playground Area – The Upper Noise Limit

4.6 The noise levels measured at location 1, 2, 3, and 4 exceed the upper limit of 55dB(A)  $L_{Aeq30min}$  as recommended by BB93 for an unoccupied playground, playing field, or other outdoor area.

4.7 In order for the upper limit noise level to be met at the northern and eastern boundaries of the site, it will be necessary to offset any playground, playing field, or other outdoor area away from the road network. Using a line source distance attenuation calculation, the offset distances presented in Table 4.2 will be required in order for a noise level of 55dB(A)  $L_{Aeq30min}$  to be achieved. The calculations can be seen in **Appendix A**.

**Table 4.2 Offset distances required**

Boundary	Monitoring location	Dominant noise source	Offset distance from dominant noise source required
Northern	1	A412 east of A405 roundabout	76m
	2	A412 west of A405 roundabout	33m
Western	3	A412 west of A405 roundabout	42m
	4	Maple Lodge Close	3m

#### School Building Areas

4.8 The noise levels measured at Locations 3 and 4 on the western boundary meet the required upper permitted noise level presented in BB93 at the boundary of a proposed school building.

4.9 The noise levels at Locations 1 and 2 on the northern boundary exceed the upper  $L_{Aeq30min}$  noise level presented in BB93 for the location of a proposed school building. At these locations, road traffic using the A412 was the dominant noise source.

4.10 Using a line source distance attenuation calculation it can be inferred that at a distance 24m from the A412 to the east of the roundabout with the A405, and 10.3m from the A412 to the west of the roundabout, the upper noise limit of 60dB(A)  $L_{Aeq30min}$  can be achieved. The calculations can be seen in **Appendix A**.

4.11 An alternative to using distance to achieve acceptable noise levels on the north-western boundary of the site would be to use a noise barrier. In accordance with BB93, a noise barrier can reduce noise levels from traffic by up to 10dB(A). It is understood that an earthworks bund would be the preferable form of barrier in terms of visual impact and biodiversity. Preliminary calculations indicate that a 3.0m high barrier will be sufficient to provide the necessary noise level reduction.

## 5 Construction Impacts

### General

- 5.1 In terms of construction, the main noise impacts that are required to be considered are the generation of noise arising from construction plant. For this site sensitive receptors are located on the A412.

### Recommended Measures

- 5.2 To minimise the impact of construction noise it is recommended that the following measures are implemented:
- Noise-generating plant should be placed as far as possible from sensitive receptors.
  - Where possible, fixed plant/facilities should be powered by shore-supply rather than by generators.
  - Construction plant and equipment should be:
    - Maintained to ensure optimum performance.
    - Fitted with appropriate silencers, mufflers or acoustic screens.
    - Operated in a manner that will reduce noise emissions.
  - Vehicles and plant should be switched off, or throttled down to a minimum, when not in use.
  - Nearby residents should be shielded from noise by temporary noise hoardings located along the perimeter of the work site.
  - Where practical, mulching-breaking equipment should be used in preference to percussion-breaking machines.
  - The (general) permitted hours of site operation are limited to:
    - Monday to Friday 0:800 hrs to 18:00 hrs.
    - Saturday 08:00hrs to 13:00 hrs.
    - No working on Sunday or Bank Holidays.

## 6 Conclusions

- 6.1 The measured noise levels taken at the boundary of the site exceeded the ideal noise limit as prescribed by BB93 for an area to be used for outdoor teaching. However, calculations have shown that at a distance of 120m from the A412 or 8.5m from Maple Lodge Close the lower limit can be achieved.
- 6.2 The measured noise levels taken at the boundary of the site exceeded the upper noise limit as prescribed by BB93 for an area used for outdoor teaching. However, calculations have shown that that at the distances listed below from the surrounding road network, the upper limit can be achieved on the site.
- Location 1: 76m from the A412 to the east of the A405 roundabout.
  - Location 2: 33m from the A412 to the west of the A405 roundabout.
  - Location 3: 42m from the A412 to the west of the A405 roundabout.
  - Location 4: 3m from Maple Lodge Close.
- 6.3 The measured noise levels at locations 3 and 4 away from the A412 meet the required upper permitted noise level presented in BB93 at the boundary of a proposed school building. Calculations have shown that 24m in from the A412 to the east of the roundabout with the A405, and 10.30m from the A412 to the west of the roundabout, the upper limit can be met.
- 6.4 An alternative to using distance to achieve acceptable noise levels at the northern boundary of the site would be to use a noise barrier along the north-western site boundary in the vicinity of locations 1 and 2. In accordance with BB93, a noise barrier could reduce noise levels from traffic by up to 10dB(A). The noise barrier is likely to take the form of an earthworks bund. Preliminary calculations indicate that a height of 3.0m will be sufficient to achieve the require noise level reductions.
- 6.5 The preliminary findings described in this report indicate that, with appropriate mitigation measures in place, noise issues will not preclude the development of a new secondary school on this site. A full Noise Assessment will be required to support any future planning application made for the site. This will provide details the noise mitigation measures, such as the dimensions of any noises barriers, required for the site to be developed.

## Appendix A

### Calculations

---

Job No	Report No	Issue no	Report Name	Page
MID3172	R.007	1	South West Hertfordshire Secondary Schools Site B	A1

## Line Source Distance Calculations

Distance Corrected Noise Level =  $10 \text{ LOG}_{10} (R/r)$

where  $R$  = Distance from the road to the point the measurement was taken

where  $r$  = Distance from the road to the point where the measurement is to be corrected to

## Playground Area – The Ideal Noise Limit

In order to meet the required noise level of  $L_{Aeq\ 30\ mins}$  50dB(A) the following offset distances will be required.

**Table A.1 Playground Area – Ideal Noise Limit**

Boundary	Monitoring location	Dominant noise source	Calculation	Offset distance required
Western	4	Maple Lodge Close.	$10 \text{ LOG}_{10} (1/8.50) = -9.2$ $59.2 - 9.2 = 50\text{dB(A)}$	8.5m from Maple Lodge Close
Western	3	A412 west of A405 roundabout	$10 \text{ LOG}_{10} (30/120) = -6.0$ $56 - 6 = 50\text{dB(A)}$	120m from A412

## Playground Area – The Upper Noise Limit

In order to meet the required noise level of  $L_{Aeq\ 30\ mins}$  55dB(A) the following offset distances will be required.

**Table A.2 Playground Area – Upper Noise Limit**

Boundary	Monitoring location	Dominant noise source	Calculation	Offset distance required
Northern	1	A412 east of A405 roundabout	$10 \text{ LOG}_{10} (10/76) = -8.8$ $63.8 - 8.8 = 55\text{dB(A)}$	76m from A412
Northern	2	A412 west of A405 roundabout	$10 \text{ LOG}_{10} (10/33) = -5.1$ $60.1 - 5.1 = 55\text{dB(A)}$	33m from A412
Western	3	A412 west of A405 roundabout	$10 \text{ LOG}_{10} (30/42) = -1.5$ $56.0 - 1.5 = 54.5\text{dB(A)}$	42m from A412
Western	4	Maple Lodge Close	$10 \text{ LOG}_{10} (1/3) = -4.7$ $59.2 - 5.1 = 54.5\text{dB(A)}$	3m from Maple Lodge Close.

## School Buildings – The Upper Noise Limit

In order to meet the required noise level of  $L_{Aeq\ 30\ mins}$  60dB(A) the following offset distances will be required.

**Table A.3 School Buildings – Upper Noise Limit**

Boundary	Monitoring location	Dominant noise source	Calculation	Offset distance required
Northern	1	A412 east of A405 roundabout	$10 \text{ LOG}_{10} (10/24) = -3.8$ $63.8 - 8.8 = 60\text{dB(A)}$	24m from A412
Northern	2	A412 west of A405 roundabout	$10 \text{ LOG}_{10} (10/10.30) = -0.1$ $60.1 - 0.1 = 60\text{dB(A)}$	10.3m from A412